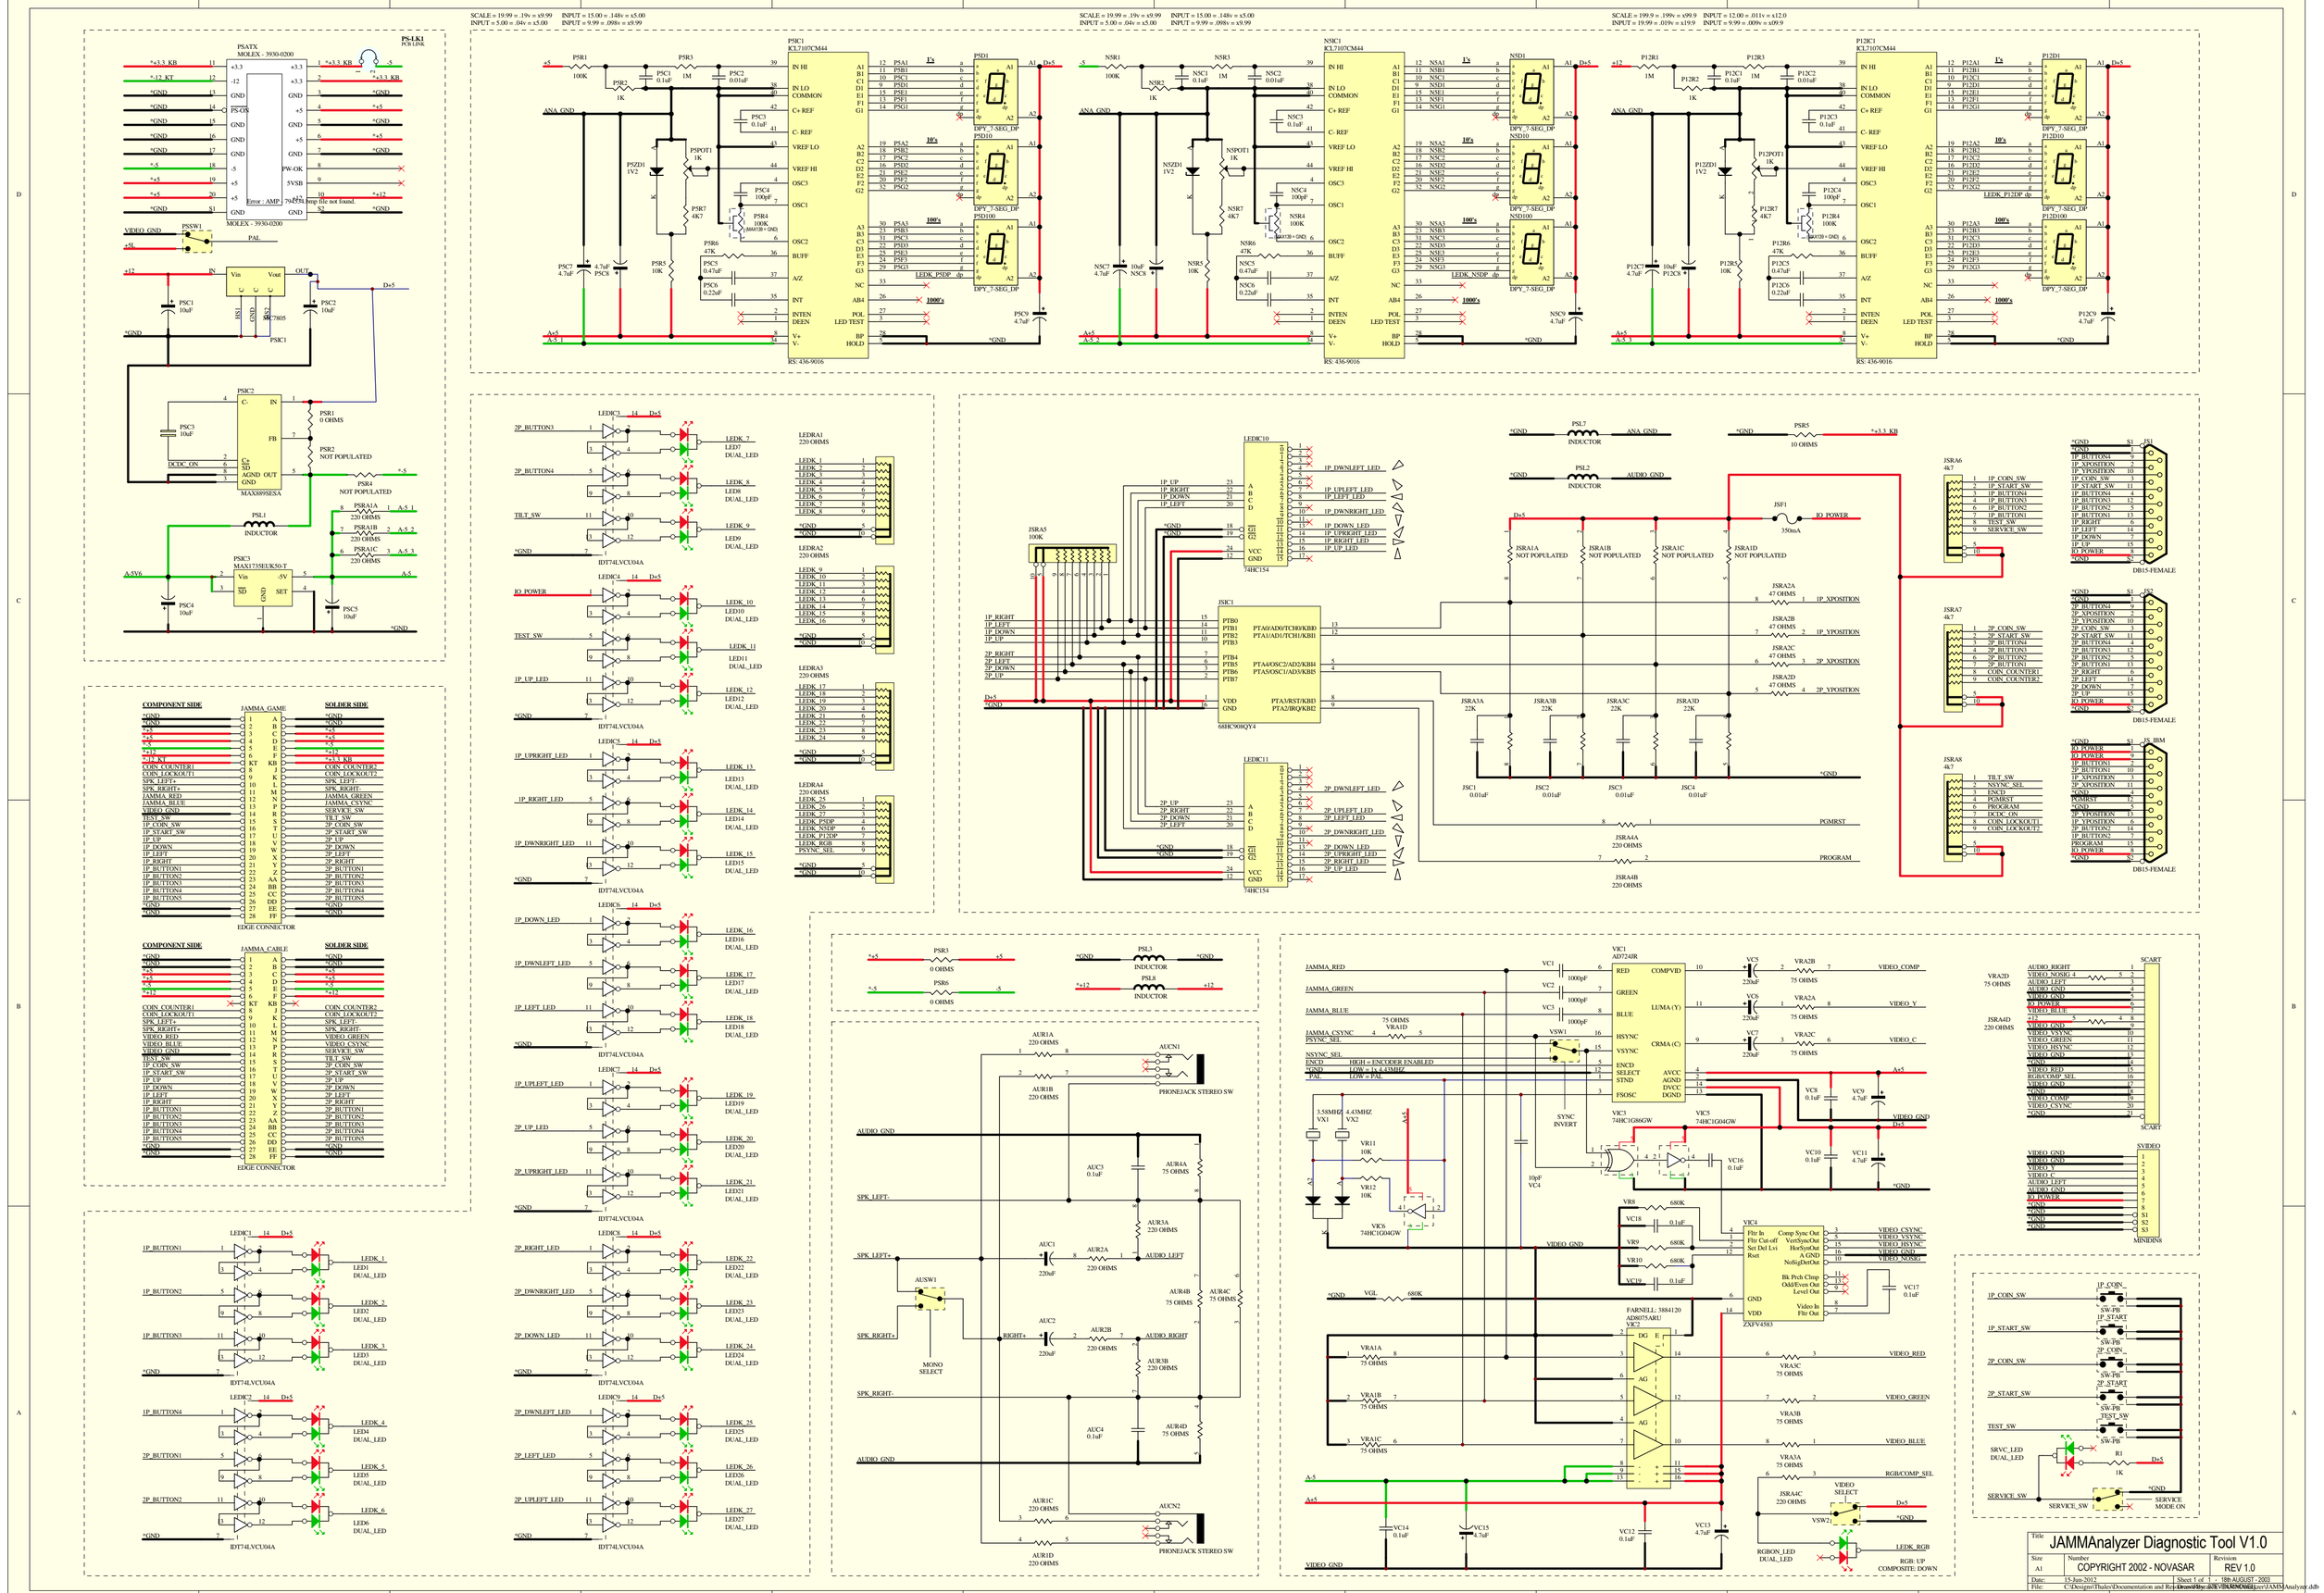
PS-LK1
PCB LINK
PSATX
MOLEX - 3930-0200
Error : AMP 794194 temp file not found.
VIDEO_GND
PSSW1
PAL
PSC1
PSC2
PSC3
PSC4
PSC5
PSR1
0 OHMS
PSR2
NOT POPULATED
PSR4
NOT POPULATED
PSR4A
PSR4B
PSL1
INDUCTOR
PSIC3
MAX1735EUK50-T
DCDC_ON
MAXS99SESA
PSIC1
PSIC2
PSR5
PSR6
PSL3
PSL8
PSL7
PSL2
AUDIO_GND
JSR5
100K
JSIC1
68HC908QY4
LEDIC10
LEDIC11
74HC154
JSR1A
JSR1B
JSR1C
JSR1D
NOT POPULATED
JSR2A
JSR2B
JSR2C
JSR2D
47 OHMS
JSR3A
JSR3B
JSR3C
JSR3D
22K
JSC1
JSC2
JSC3
JSC4
0.01uF
JSR4A
JSR4B
220 OHMS
PGMRST
PROGRAM
JSF1
350mA
IO_POWER
JSR6
JSR7
JSR8
4k7
JS1
JS2
JS_IBM
DB15-FEMALE
COMPONENT SIDE
SOLDER SIDE
JAMMA_GAME
EDGE CONNECTOR
JAMMA_CABLE
SCART
SVIDEO
MINIDIN5
AUDIO_RIGHT
AUDIO_LEFT
VIDEO_GND
VIDEO_COMP
VIDEO_Y
VIDEO_C
VIDEO_RED
VIDEO_GREEN
VIDEO_BLUE
RGB/COMP_SEL
VIDEO_CSYNC
VIDEO_VSYNC
VIDEO_HSYNC
VIDEO_NOSIG
VIC1
AD724JR
VIC3
74HC1G86GW
VIC5
74HC1G04GW
VIC6
74HC1G04GW
VIC4
ZXFV4583
FARNELL: 3884120
AD8075ARU
VIC2
VRA2B
VRA2A
VRA2C
VRA2D
VRA1A
VRA1B
VRA1C
VRA3B
VRA3A
VRA4C
VRA4D
75 OHMS
VSW1
VSW2
VIDEO SELECT
RGBON_LED
DUAL_LED
RGB: UP
COMPOSITE: DOWN
SERVICE_SW
SERVICE MODE ON
JAMMAnalyzer Diagnostic Tool V1.0
COPYRIGHT 2002 - NOVASAR
REV 1.0
Size A1
Number
Revision
Date: 15-Jun-2012
Sheet 1 of 1 - 18th AUGUST - 2003
File: C:\Designs\Thales\Documents and Reports\Jammer\JAMMAnalyzer.ddb
Drawn By: ALAN MOORE